


SUPERSCAN QUICK DISCONNECT CABLE

- 2 P IMP
- 5 P DET
- 13 SWITCH 1 (F11)
- 17 +24VDC
- 18 - 24VDC

**EAGLE or SENTRYSCAN**



- POWER 1 red
- POWER 2 black
- COM white
- N.O. green
- N.C. blue

- SAFETY SIDE SUPERSCAN**
- 1 EMPTY
  - 2 INHIBIT GND 2
  - 3 INHIBIT +
  - 4 N.C.
  - 5 N.O.
  - 6 COM
  - 7 POWER
  - 8 POWER



- APPROACH SIDE SUPERSCAN**
- 1 EMPTY
  - 2 INHIBIT GND 2
  - 3 INHIBIT +
  - 4 N.C.
  - 5 N.O.
  - 6 COM
  - 7 POWER
  - 8 POWER

- BODYGUARD**
- 7 blue DATA +
  - 6 brown DATA -
  - 5 N.C.
  - 4 green N.O.
  - 3 white COM
  - 2 black POWER 2
  - 1 red POWER 1

**Bodyguard or PassPort Presence Sensor**

**CUP V 6.3 / 6.4**

- 3 I IMP
- 4 0 VDC
- 9 MAT LOGIC
- 19 + 18 VDC
- 14 SWITCH 2 (F12)

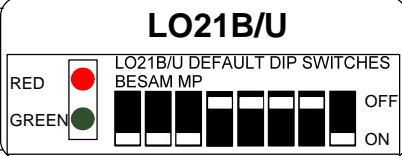

(switches 1 thru 5 lockout time)  
6 off, 7 off, 8 on

NOTES: 1) SET PMD F20 = b, F19 = b, F18=00, F17=00, F16=05, F14=a, F13=a, F12 = 3 degrees LESS THAN F10, F11 = 25 degrees LESS THAN F10

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM

**BEA**  
We open up New Horizons  
A HALMA GROUP COMPANY

100 ENTERPRISE DRIVE  
PITTSBURGH, PA 15275  
PHONE: (412) 249-4100  
FAX: (412) 249-4101  
EMAIL: www.beasensors.com

**TITLE: BESAM MP SINGLE WITH PASSPORT PLUS / PARALLAX, Q-DISCONNECT ON SAFETY SIDE**

SIZE: <b>A</b>	DRAWN BY: KJG	REV BY: WJR	PART NO: <b>80.0044.06</b>
	SCALE: NONE	DATE: 07 NOV 08	SHEET 1 OF 1