

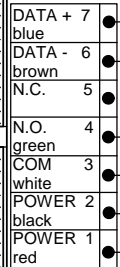



**BODYGUARD**





**EAGLE**



**SUPERSCAN**

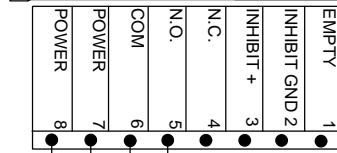

SAFETY BEAM INPUT  
DRY CONTACT ONLY  
(SEE NOTE #2)

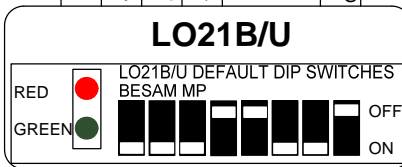

- TB2-2  
+TB2-4

**CSDA**

• TB1-4 ACTIVATION  
• TB2-2 COMMON  
• TB2-1 SAFETY

**SOLENOID**

**BEA**  
We open up New Horizons  
HALMA GROUP COMPANY

100 ENTERPRISE DRIVE  
PITTSBURGH, PA 15275  
PHONE: (412) 249-4100  
FAX: (412) 249-4101  
EMAIL: www.beasensors.com

**TITLE: POWER SWING LE OPERATOR LO21B/U  
WITH PASSPORT SYSTEM BODYGUARD  
APPROACH SIDE SUPERSCAN**

SIZE: <b>A</b>	DRAWN BY: KJG	REV BY: WJR	PART NO: <b>80.0141.04</b>
	SCALE: NONE	DATE: 07 NOV 2008	SHEET 1 OF 1

- NOTES: 1) REMOVE JUMPER #7 THIS ALLOWS THE BODYGUARD TO SAFETY THE DOOR.  
2) WHEN USING SAFETY BEAM, USE MICROCELL 1 OR SBK30. SBK-111 WILL NOT WORK.  
3) DIPSWITCHES 1 THRU 5 LOCKOUT TIME, 6 ON, 7 ON, 8 OFF.

IF AFTER TROUBLESHOOTING A PROBLEM, A SATISFACTORY SOLUTION CANNOT BE ACHIEVED, PLEASE CALL B.E.A., INC. FOR FURTHER ASSISTANCE DURING EASTERN STANDARD TIME AT 1-800-523-2462 FROM 8AM - 5PM. FOR AFTER-HOURS, CALL EAST COAST: 1-866-836-1863 OR 1-800-407-4545 / MID-WEST: 1-888-308-8843 / WEST COAST: 1-888-419-2564. DO NOT LEAVE ANY PROBLEM UNRESOLVED. IF YOU MUST WAIT FOR THE FOLLOWING WORKDAY TO CALL B.E.A., LEAVE THE DOOR INOPERABLE UNTIL SATISFACTORY REPAIRS CAN BE MADE. NEVER SACRIFICE THE SAFE OPERATION OF THE AUTOMATIC DOOR OR GATE FOR AN INCOMPLETE SOLUTION.WEB: WWW.BEASENSORS.COM